




The AP Series provides a pure analog signal excellent for high resolution and high frequency applications, and other custom circuits.

COMPANY: Merit Sensor is a leader in piezoresistive pressure sensing and partners with clients to create high performing solutions for a variety of applications and industries.

TECHNOLOGY: Merit Sensor utilizes a piezoresistive Wheatstone bridge with a chemically etched silicon diaphragm. All products are RoHS and REACH compliant.

CAPABILITIES: Merit Sensor designs, engineers, fabricates, dices, assembles, and tests products from a state-of-the-art facility near Salt Lake City, Utah.

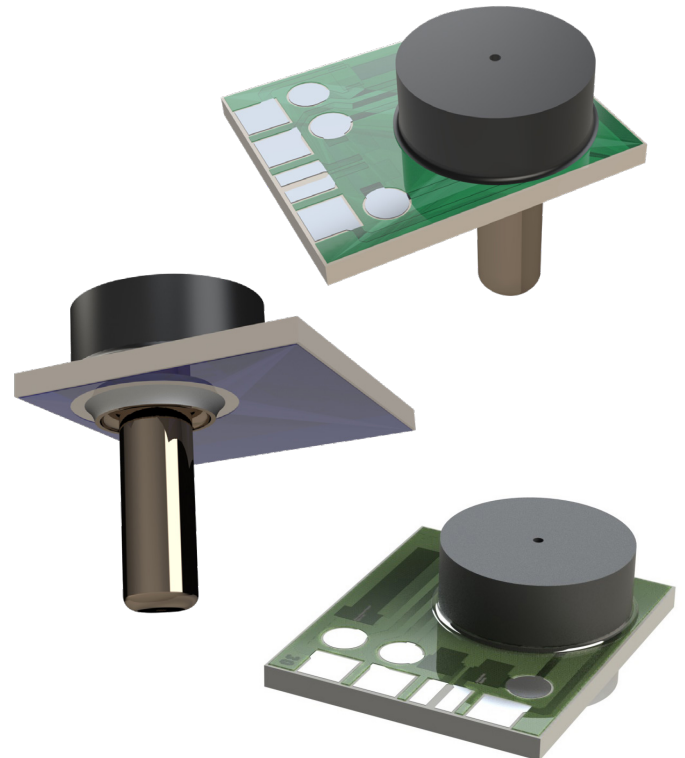


FEATURES

Ranges	0 to 1000 psi (0 to 70 bar)
Type	Gage, vacuum
Media	Air, gases and liquids

BENEFITS

Performance	Enjoy best-in-class performance due to Merit's proprietary Sentium technology.
Speed	Get to market quickly with creative and flexible solutions
Service	Experience prompt, personal, and professional support

AP SERIES Part Number Configurator

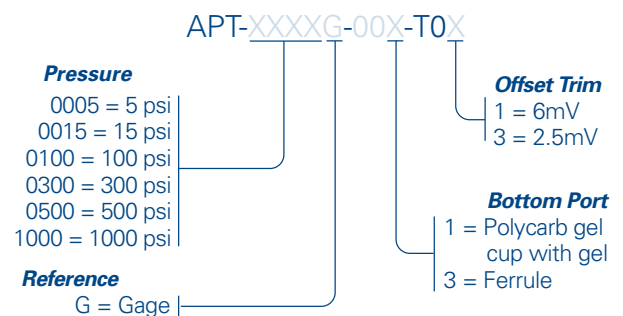

Example: APT-0300G-001-T01 offers 300psi, Gage, Polycarb port with gel, 6mV offset


SPECIFICATIONS

Parameter	Minimum	Typical	Maximum	Units	Notes
Electrical (22°C unless otherwise stated)					
Input Excitation	1	5	10	VDC	
Input Impedance	6000	12000	16000	ohms	
Output Impedance	4000	5000	6000	ohms	
Environmental					
Temp (Comp/Operating)	10	25	40	°C	
Temperature (Storage)	-55		60	°C	
Weight		1.17		Grams	Polycarb with gel
Performance					
Accuracy*	-2	0	2	%FSO	10° – 40°C
Burst Pressure	3X				Full scale pressure
Burst Pressure (1000 psi part)		1500		psi	
Part	Full-Scale Pressure (psi)	Offset (mV @5V)	Full-Scale Output (mV @5V)	Sensitivity (mV/V/psi)	
APT-0005G-003-T03	5	2.5	50	1.900	
APT-0015G-003-T03	15	2.5	50	0.633	
APT-0100G-003-T03	100	2.5	100	0.195	
APT-0300G-001-T01	300	6.0	98.3	0.062	
APT-0300G-003-T03	300	2.5	100	0.065	
APT-0500G-003-T03	500	2.5	100	0.039	
APT-1000G-003-T03	1000	2.5	100	0.020	


* The combined effect of Sensitivity, Nonlinearity, and Hysteresis errors over the operating temp range.

DIMENSIONS (millimeters)

Pin Out	
1	+ Out
2	- In
3	- In
4	- Out
5	+ In

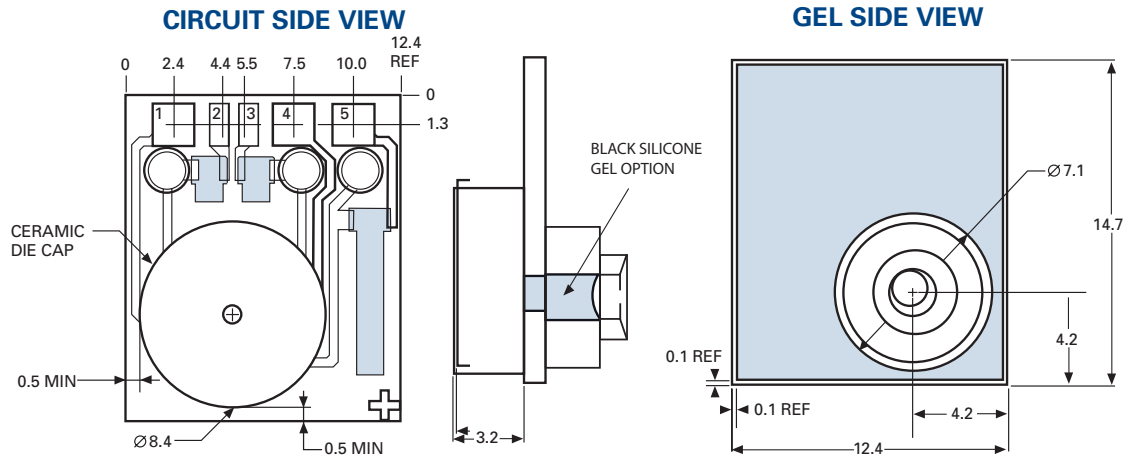

FERRULE SIDE VIEW

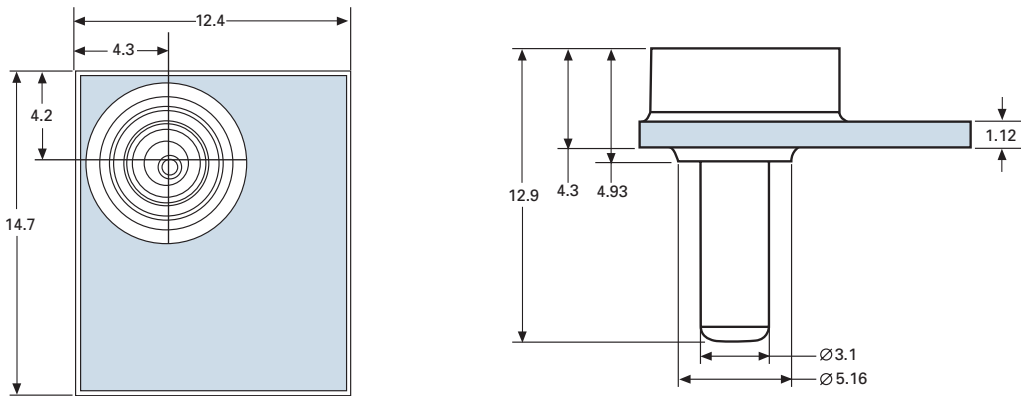

TRANSFER FUNCTION EXAMPLE

300psi T01 Transfer Function
(Sensor pn APT-0300G-001-T01):

$$V_{out} = (0.308 P) + \text{Offset} \pm \text{Error}$$

*This graph assumes Offset = 6mV, error = 0mV,
Vs = 5.0V, and TEMP = 25°C*

